SHOW CHROME

Copyright[©] 2022 by Big Bike Parts, Inc. No part of this instruction sheet may be reproduced without the written permission of Big Bike Parts, Inc.

INSTALLATION INSTRUCTIONS

PART NO. 44-106/44-106BK

DESCRIPTION: FLAG POLE - NON-FOLDING


ESTIMATED INSTALLATION TIME: 10 TO 15 MIN | FITMENT: | POLARIS SLINGSHOT 2015 - NEWER

TOOLS NEEDED:	REMOVABLE THREAD LOCK	4MM ALLEN WRENCH	T40 TORX	
INCLUDED:	FLAG MOUNT (1X)	FLAG POLE ASSEMBLY (1X)	U.S. FLAG (1X)	
EXTRA ITEMS (NOT NEEDED):	N/A			

PLEASE READ THROUGH AND UNDERSTAND THESE INSTRUCTIONS BEFORE BEGINNING. *USE REMOVABLE THREAD LOCK ON ALL FASTENERS*

INSTALLATION:

- 1. ASSEMBLE THE FLAG ONTO THE FLAG POLE BY REMOVING THE RUBBER O-RING FROM THE FLAG POLE AND SLIDING THE FLAG ONTO THE BOTTOM OF THE FLAG POLE WITH THE RUBBER O-RING REINSTALLED UNDER THE FLAG TO HOLD IT FROM SLIDING DOWN (FIG. 1).
- 2. USE A 4MM ALLEN WRENCH TO INSTALL THE FLAG POLE ONTO THE FLAG MOUNT USING THE TWO M6 FLAT WASHERS AND M6-1.0X16MM LONG BUTTON SOCKET HEAD SCREW ACCORDING TO FIG. 1 USING REMOVABLE THREAD LOCK ON THE HARDWARE. NOTE: BE SURE FLAG POLE FOLDS FORWARD TOWARDS THE MOUNT BEFORE TIGHTENING COMPLETELY.
- 3. USING A T40 TORX, REMOVE THE SCREW FROM THE BACK SIDE OF THE ROLL HOOP TRIM (FIG. 2). THIS SCREW WILL NOT BE REUSED. NOTE: THIS FLAG POLE CAN BE MOUNTED IN ANY OF THE 4 SCREW LOCATIONS ON THE BACK SIDE OF THE ROLL HOOP TRIM.
- 4. INSTALL THE FLAG POLE ASSEMBLY TO THE REAR OF THE ROLL HOOP WHERE YOU REMOVED THE SCREW IN STEP 1 USING THE M6-1.0X16MM LONG BUTTON SOCKET HEAD SCREW AND A 4MM ALLEN WRENCH (FIG. 3).

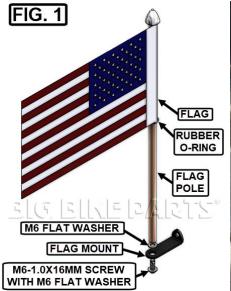





WARNING

THREADLOCK CAUSES PLASTICS TO CRACK, BREAK OR BECOME BRITTLE. WHEN USING THREADLOCK TO INSTALL HARDWARE WITH PLASTIC COMPONENTS, ONLY APPLY TO METAL COMPONENTS, IT IS CRITTCAL THAT ANY EXCESS THREADLOCKER OR SPILLAGE IS CLEANED COMPLETELY FROM PLASTIC COMPONENTS IMMEDIATELY BEFORE DRIVING, A DAMP TOWEL OR RAG IS THE BEST WAY TO ACHIEVE THIS. IF EXCESS THREADLOCKER IS NOT CLEANED UP RIGHT AWAY, IT COULD LEAD TO DAMAGED PRODUCTS AND VOID WARRANTY.

NOTICE

IGNORING THE CONTENTS OF THESE
INSTRUCTIONS MAY AFFECT THE PRODUCT
PERFORMANCE AND FUNCTIONALITY. NOT
FOLLOWING THESE INSTRUCTION MAY CAUSE
DAMAGE TO THE PRODUCT OR THE VEHICLE
TO WHICH IT IS BEING ATTACHED.